

SAFETY DATA SHEET

Section 1: Manufacturer's Identification

Product Name: U50 ACCELERATOR Product Code: Q-5055

Manufacturer's Name: Induron Protective Coatings, LLC
Address: 3333 Richard Arrington Blvd. N.
Birmingham, Alabama 35234

Emergency Phone: 1-800-424-9300
Information Phone: (205)324-9584

Section 2: Composition / Information on Ingredients

GHS Ratings:

Flammable liquid	3	Flash point $\geq 23^{\circ}\text{C}$ and $\leq 60^{\circ}\text{C}$ (140°F)
Skin corrosive	2	Reversible adverse effects in dermal tissue, Draize score: $\geq 2.3 < 4.0$ or persistent inflammation
Eye corrosive	2A	Eye irritant: Subcategory 2A, Reversible in 21 days
Carcinogen	2	Limited evidence of human or animal carcinogenicity
Reproductive toxin	1B	Presumed, Based on experimental animals
Aspiration hazard	1	Aspiration Toxicity Category 1: Known (regarded)- human evidence - hydrocarbons with kinematic viscosity ≥ 20.5 mm ² /s at 40° C.

GHS Hazards

H226	Flammable liquid and vapour.
H304	May be fatal if swallowed and enters airways
H315	Causes skin irritation
H319	Causes serious eye irritation
H351	Suspected of causing cancer
H360	May damage fertility or the unborn child

GHS Precautions

P201	Obtain special instructions before use
P202	Do not handle until all safety precautions have been read and understood
P210	Keep away from heat/sparks/open flames/hot surfaces - No smoking.
P233	Keep container tightly closed.
P240	Ground/bond container and receiving equipment.
P241	Use explosion-proof electrical equipment.
P242	Use only non-sparking tools.
P243	Take precautionary measures against static discharge.
P264	Wash equipment and contaminated skin thoroughly after handling.
P280	Wear protective gloves/protective clothing/eye protection/face protection.
P281	Use personal protective equipment as required
P321	Wash contaminated skin, follow Physician's instructions for treatment.
P331	Do NOT induce vomiting
P362	Take off contaminated clothing and wash before reuse
P301+P310	IF SWALLOWED: Immediately call a POISON CENTER or doctor/physician
P302+P352	IF ON SKIN: Wash with soap and water
P303+P361+P353	IF ON SKIN (or hair): Remove/Take off immediately all contaminated clothing. Rinse skin with water/shower
P305+P351+P338	IF IN EYES: Rinse continuously with water for several minutes. Remove contact lenses if present and easy to do – continue rinsing
P308+P313	IF exposed or concerned: Get medical advice/attention
P332+P313	If skin irritation occurs: Get medical advice/attention
P337+P313	Get medical advice/attention

P370+P378
P405
P403+P235
P501

In case of fire: Use CO2, water spray, foam, or dry chemical to extinguish.
Store locked up
Store in a well ventilated place. Keep cool
Dispose of contents/container in accordance to appropriate regulations and laws.

Signal Word: Danger



Preexisting skin, eye, and respiratory disorders may be aggravated by exposure to this product. Impaired kidney and liver functions from preexisting disorders may be aggravated by exposure to this product.

Kidney damage may be evidenced by changes in urine output, urine appearance, or edema (swelling from fluid retention). Liver damage may be evidenced by loss of appetite, jaundice and sometimes pain in the upper abdomen on the right side.

Section 3: Hazards Identification

Chemical Name	CAS number	Weight Concentration %
Mixed Xylenes	1330-20-7	70.00% - 80.00%
2-ETHYL BENZENE	100-41-4	20.00% - 30.00%
DIBUTYL TIN DILAURATE	77-58-7	1.00% - 5.00%

Section 4: First Aid Measures

INHALATION - If product solids are inhaled either as dust or in the form of a spray mist, remove the person from exposure immediately. If breathing is difficult, irregular, or has stopped, start resuscitation; call a physician. Administer oxygen if a qualified operator is available.

EYE CONTACT - In case of eye contact, flush the eyes with water for fifteen (15) minutes. If contact lenses are worn, quickly remove them, then flush the eyes with water. Have a physician examine the eyes.

SKIN CONTACT - In case of skin contact, remove contaminated clothing. Flush the skin with large amounts of water, then wash the skin with soap and water.

INGESTION - If material is ingested, seek immediate medical attention. If vomiting occurs spontaneously, keep the head below the hips to prevent aspiration of liquid into the lungs.

Notes to Physician: No data found

Section 5: Fire Fighting Measures

Flash Point: 27 C (80 F)

LEL: 1.00

UEL: 7.00

EXTINGUISHING MEDIA: Use carbon dioxide (CO2), "alcohol" foam, dry chemical, or water spray/water fog extinguishing systems.

UNUSUAL FIRE OR EXPLOSION HAZARDS: The product vapor is heavier than air and may travel a considerable distance to a source of ignition and flashback.

HAZARDOUS COMBUSTION PRODUCTS: See section 10 for a list of hazardous decomposition products for this mixture.

FIRE FIGHTING: If evacuation of personnel is necessary, evacuate to an upwind area. Decontaminate personnel and equipment with a water wash-down after fire and smoke exposure.

FIRE FIGHTING: If evacuation of personnel is necessary, evacuate to an upwind area. Decontaminate personnel and equipment with a water wash-down after fire and smoke exposure.

Section 6: Accidental Release Measures

SPILL AND LEAK PROCEDURES: Spill supervisor - Ensure cleanup personnel wear all appropriate Personal Protective Equipment (PPE), including respiratory protection. Remove all ignition sources. Keep nonessential personnel away from the contaminated area.

SMALL SPILLS: Ventilate the contaminated area. Using nonsparking tools, mix the appropriate sorbent into the spilled material. Use an absorbent like sawdust for aqueous, waterborne, and solvent-borne coatings.

Collect the saturated sorbent and transfer it into a covered container. Steel containers are acceptable for all wastes except wastes which contain acid. Use suitable plastic containers for acid-bearing wastes.

Dispose of the waste in compliance with all Federal, state, regional, and local regulations.

LARGE SPILLS: Prevent this material from entering sewers and watercourses by diking or impounding the spilled material. Advise authorities if the product has entered or may enter, sewers, watercourses, or extensive land areas.

Ventilate the contaminated area. Using nonsparking tools, mix the appropriate sorbent into the spilled material. Use an absorbent like sawdust for aqueous, waterborne, and solvent-borne coatings.

Collect the saturated sorbent and transfer it into a covered container. Steel containers are acceptable for all wastes except wastes which contain acid. Use suitable plastic containers for acid-bearing wastes.

Section 7: Handling and Storage

HANDLING PRECAUTIONS: Wear all appropriate Personal Protective Equipment (PPE). Wear respiratory protection or ensure adequate ventilation at all times as vapors can accumulate in confined or poorly ventilated areas. Use the product in a manner which minimizes splashes and/or the creation of dust. Keep containers closed when not in use. Do not handle or store material near heat, sparks, open flames, or other sources of ignition. Store at room temperatures, i.e., 40 to 95 F (4 to 35 C).

STORAGE: Prevent from freezing. Do not store above 120 F (49 C).

Store only in original containers.

REGULATORY REQUIREMENTS: No data found.

Section 8: Exposure Controls / Personal Protection

Chemical Name / CAS No.	OSHA Exposure Limits	ACGIH Exposure Limits	Other Exposure Limits
Mixed Xylenes 1330-20-7	100 ppm TWA; 435 mg/m3 TWA	150 ppm STEL 100 ppm TWA	Not Established
2-ETHYL BENZENE 100-41-4	100 ppm TWA; 435 mg/m3 TWA	20 ppm TWA	NIOSH: 100 ppm TWA; 435 mg/m3 TWA 125 ppm STEL; 545 mg/m3 STEL
DIBUTYL TIN DILAURATE 77-58-7	Not Established	Not Established	Not Established

ENGINEERING: Ensure processing (curing) ovens are properly vented to prevent the introduction of processing fumes into the workplace. Use explosion-proof equipment and good manufacturing practice.

VENTILATION: Use only with adequate ventilation, i.e., ventilation in compliance with occupational exposure limits.

ADMINISTRATIVE CONTROLS: No data found.

PROTECTIVE EQUIPMENT: Wear splash goggles. If extra protection is required, wear a face shield over the splash goggles. Face shields are effective only if worn in addition to splash goggles.

Wear a chemical-resistant, butyl-rubber apron and other protective clothing, as deemed appropriate, to avoid skin

contact with material.

Wear chemical-resistant gloves (butyl rubber or neoprene). Protective gloves should be inspected frequently and discarded when they exhibit cuts, tears, pinholes, or signs of excessive wear.

CONTAMINATED EQUIPMENT: Dispose of the waste in compliance with all Federal, state, regional, and local regulations.

Section 9: Physical and Chemical Properties

This mixture typically exhibits the following properties under normal circumstances:

Viscosity: N/A Appearance: N/A Vapor Pressure: 7.1 mmHg Vapor Density: 3.7 DENSITY: 7.25 Freezing point: N/A Boiling range: 136°C Evaporation rate: N/A Explosive Limits: N/A Autoignition temperature: N/A	Coating VOC Lb/Gal: 7.16 Odor: N/A Odor threshold: N/A pH: N/A Melting point: N/A Solubility: N/A Flash point: 80 F, 27 C Flammability: N/A Partition coefficient (n-octanol/water): N/A Decomposition temperature: N/A
--	--

Section 10: Stability and Reactivity

Stability:

STABLE

Components of this mixture are incompatible with the following materials:

This mixture is likely to exhibit the following combustion products:

Hazardous polymerization will not occur.

Section 11: Toxicological Information

Mixture Toxicity

Oral Toxicity LD50: 3,543mg/kg

Inhalation Toxicity LC50: 25mg/L

Routes of Entry:

Exposure to this material may affect the following organs:

Eyes Central Nervous System Skin Respiratory System

Effects of Overexposure

Carcinogenicity: The following chemicals comprise 0.1% or more of this mixture and are listed and/or classified as carcinogens or potential carcinogens by NTP, IARC, OSHA (mandatory listing), or ACGIH (optional listing).

<u>CAS Number</u>	<u>Description</u>	<u>% Weight</u>	<u>Carcinogen Rating</u>
100-41-4	2-ETHYL BENZENE	20 to 30%	2-ETHYL BENZENE: IARC: Possible human carcinogen OSHA: listed

Section 12: Ecological Information

Ecological information: No data found.

Component Ecotoxicity

Mixed Xylenes

96 Hr LC50 Pimephales promelas: 13.4 mg/L [flow-through]; 96 Hr LC50 Oncorhynchus mykiss: 2.661 - 4.093 mg/L [static]; 96 Hr LC50 Oncorhynchus mykiss: 13.5 - 17.3 mg/L; 96 Hr LC50 Lepomis macrochirus: 13.1 - 16.5 mg/L [flow-through]; 96 Hr LC50 Lepomis macrochirus: 19 mg/L; 96 Hr LC50 Lepomis macrochirus: 7.711 - 9.591 mg/L [static]; 96 Hr LC50 Pimephales promelas: 23.53 - 29.97 mg/L [static]; 96 Hr LC50 Cyprinus carpio: 780 mg/L [semi-static]; 96 Hr LC50 Cyprinus carpio: >780 mg/L; 96 Hr LC50 Poecilia reticulata: 30.26 - 40.75 mg/L [static]
48 Hr EC50 water flea: 3.82 mg/L; 48 Hr LC50 Gammarus lacustris: 0.6 mg/L

2-ETHYL BENZENE

96 Hr LC50 Oncorhynchus mykiss: 11.0 - 18.0 mg/L [static]; 96 Hr LC50 Oncorhynchus mykiss: 4.2 mg/L [semi-static]; 96 Hr LC50 Pimephales promelas: 7.55 - 11 mg/L [flow-through]; 96 Hr LC50 Lepomis macrochirus: 32 mg/L [static]; 96 Hr LC50 Pimephales promelas: 9.1 - 15.6 mg/L [static]; 96 Hr LC50 Poecilia reticulata: 9.6 mg/L [static]
48 Hr EC50 Daphnia magna: 1.8 - 2.4 mg/L
72 Hr EC50 Pseudokirchneriella subcapitata: 4.6 mg/L; 96 Hr EC50 Pseudokirchneriella subcapitata: >438 mg/L; 72 Hr EC50 Pseudokirchneriella subcapitata: 2.6 - 11.3 mg/L [static]; 96 Hr EC50 Pseudokirchneriella subcapitata: 1.7 - 7.6 mg/L [static]

Section 13: Disposal Considerations

As the US EPA, state, regional, and other regulatory agencies may have jurisdiction over the disposal of your facility's hazardous waste, it is incumbent upon you, the hazardous waste generator, to learn of and satisfy all the requirements which affect you. Dispose of the hazardous waste at a properly licensed and permitted disposal site or facility. Ensure conformity to all applicable hazardous waste disposal regulations.

The US EPA Hazardous Waste Numbers which follow are applicable to this unadulterated product if the product enters the "waste stream." Refer to Title 40 of the Code of Federal Regulations, Part 261 (40 CFR 261). This part of the Code identifies solid wastes which are subject to regulation under various sections of the Code and which are subject to the notification requirements of Section 3010 of the Resource Conservation and Recovery Act (RCRA).

Section 14: Transport Information

Section 14 - Transport Information

<u>Agency</u>	<u>Proper Shipping Name</u>	<u>UN Number</u>	<u>Packing Group</u>	<u>Hazard Class</u>
DOT	PAINT	1263	III	3
IATA	PAINT	1263	III	3

15: Regulatory Information

State of California Safe Drinking Water and Toxic Enforcement Act of 1986 (Proposition 65): WARNING! This product contains the following chemicals which are listed by the State of California as carcinogenic or a reproductive toxin:

100-41-4 2-ETHYL BENZENE 20 to 30 %

HAZARDOUS AIR POLLUTANTS

100-41-4 2-ETHYL BENZENE

1330-20-7 Mixed Xylenes

MASSACHUSETTS RIGHT TO KNOW

100-41-4 2-ETHYL BENZENE 20 to 30 %

1330-20-7 Mixed Xylenes 70 to 80 %

NEW JERSEY RIGHT TO KNOW

100-41-4 2-ETHYL BENZENE 20 to 30 %

1330-20-7 Mixed Xylenes 70 to 80 %

PENNSYLVANIA RIGHT TO KNOW

100-41-4 2-ETHYL BENZENE 20 to 30 %

1330-20-7 Mixed Xylenes 70 to 80 %

CHEMICAL LIST FOR SARA 311

1330-20-7 Mixed Xylenes

CHEMICAL LIST FOR SARA 311/312

1330-20-7 Mixed Xylenes

CHEMICAL LIST FOR SARA 313

100-41-4 2-ETHYL BENZENE

1330-20-7 Mixed Xylenes

Country

Regulation

All Components Listed

EU Risk Phrases

Safety Phrase

- None

16: OTHER INFORMATION

Hazardous Material Information System (HMIS)

HEALTH	*	2
FLAMMABILITY		3
PHYSICAL HAZARD		0
PERSONAL PROTECTION	G	

HMIS & NFPA Hazard Rating

Legend

* = Chronic Health Hazard


0 = INSIGNIFICANT

1 = SLIGHT

2 = MODERATE

3 = HIGH

National Fire Protection Association (NFPA)

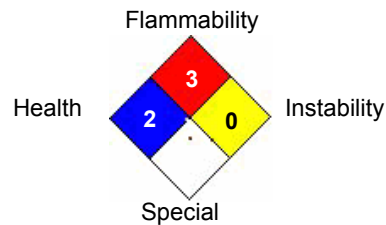

Reviewer Revision

Date Prepared: 10/19/2016