SAFETY DATA SHEET

Section 1: Manufacturer's Identification

Product Name: CERAMAPRIME EPOXY PRIMER, TAN, PART A Product Code: H-7480

Trade Name: FASTPRIME 2 EPOXY PRIMER TAN

Manufacturer's Name: Induron Protective Coatings, LLC

Address: 3333 Richard Arrington Blvd. N.

Birmingham, Alabama 35234

Emergency Phone: 1-800-424-9300 Information Phone: (205)324-9584



Section 2 : Hazards Identification

GHS Ratings:

Flammable liquid	2	Flash point < 23°C and initial boiling point > 35°C (95°F)
Skin corrosive	1C	Destruction of dermal tissue: Exposure < 4 hours Observation
		< 14 days, visible necrosis in at least one animal
Eye corrosive	1	Serious eye damage: Irreversible damage 21 days after
		exposure, Draize score: Corneal opacity >= 3, Iritis > 1.5
Skin sensitizer	1	Skin sensitizer
Mutagen	1B	Known to produce heritable mutations in human germ
		cellsSubcategory 1B, Positive results: In vivo heritable germ
		cell tests in mammals, Human germ cell tests, In vivo somatic
		mutagenicity tests, combined with some evidence of germ cell
		mutagenicity
Carcinogen	1B	Presumed Human Carcinogen, Based on demonstrated animal
		carcinogenicity
Reproductive toxin	1B	Presumed, Based on experimental animals

GHS Hazards

H225	Highly flammable
H314	Causes severe skin burns and eye damage
H317	May cause an allergic skin reaction
H318	Causes serious eye damage
H340	May cause genetic defects
H350	May cause cancer
H360	May damage fertility or the unborn child

GHS Precautions

P201	Obtain special instructions before use
P202	Do not handle until all safety precautions have been read and understood
P210	Keep away from heat/sparks/open flames/hot surfaces - No smoking.
P233	Keep container tightly closed.
P240	Ground/bond container and receiving equipment.
P241	Use explosion-proof electrical equipment.
P242	Use only non-sparking tools.
P243	Take precautionary measures against static discharge.
P260	Do not breathe dust/fume/gas/mist/vapours/spray.
P261	Avoid breathing dust/fume/gas/mist/vapours/spray.
P264	Wash equipment and contaminated skin thoroughly after handling.
P272	Contaminated work clothing should not be allowed out of the workplace.
P280	Wear protective gloves/protective clothing/eye protection/face protection.

SDS for: H-7480 Page 1 of 6

P281 Use personal protective equipment as required

P310 Immediately call a POISON CENTER or doctor/physician

P321 Wash contaminated skin, follow Physcian's instructions for treatment.

P363 Wash contaminated clothing before reuse

P301+P330+P331 IF SWALLOWED: Rinse mouth. Do NOT induce vomiting

P302+P352 IF ON SKIN: Wash with soap and water

P303+P361+P353 IF ON SKIN (or hair): Remove/Take off immediately all contaminated clothing. Rinse

skin with water/shower

P304+P340 IF INHALED: Remove victim to fresh air and keep at rest in a position comfortable for

breathing

P305+P351+P338 IF IN EYES: Rinse continuously with water for several minutes. Remove contact

lenses if present and easy to do – continue rinsing

P308+P313 IF exposed or concerned: Get medical advice/attention
P333+P313 If skin irritation or a rash occurs: Get medical advice/attention

P370+P378 In case of fire: Use CO2, water spray, foam, or dry chemical to extinguish.

P405 Store locked up

P403+P235 Store in a well ventilated place. Keep cool

P501 Dispose of contents/container in accordance to approriate regulations and laws.

Signal Word: Danger







Section 3 : Composition / Information on Ingredients

Chemical Name	CAS number	Weight Concentration %
Benzene, 1-chloro-4-(trifluoromethyl)-	98-56-6	19.00%
Titanium dioxide	13463-67-7	10.00% - 20.00%
Fatty acid polyamide	68410-23-1	9.00%
Methyl ethyl ketone	78-93-3	3.00%
Xylol	1330-20-7	3.00%
2,4,6-Tri(dimethylaminomethyl)phenol	90-72-2	2.00%
Benzene, ethyl-	100-41-4	1.00%
Aromatic naphtha, type I	64742-95-6	0.20%

Section 4: First Aid Measures

Move the exposed person to fresh air. If vapors are still present the rescuer should wear the appropriate mask. If breathing is irregular or arrest occurs use artificial respiration by trained personnel. Loosen tight fitting clothing, Get medical aid immediately.

Immediately flush eyes with plenty of water for at least 15 minutes. Regularly lift upper and lower eyelids during flushing. Remove contact lenses. Get medical aid.

Flush contaminated skin with water. Remove contaminated cloths, avoiding skin contact while doing so. Get medical attention. Clean contaminated shoes thoroughly before reuse.

Wash mouth out thoroughly. Do not induce vomiting unless directed by medical personnel. Get medical attention No specific treatment. Treat symptomatically. Contact poison treatment specialist immediately if large quantities have been inhaled or ingested.

Section 5: Fire Fighting Measures

SDS for: H-7480 Page 2 of 6

Flash Point: 16 C (61 F)

LEL: 1.0% UEL: 8.0%

For flammable liquid: Can burst from pressure if in sealed container and heated, with risk of subsequent explosion. Vapors are heavier than air, can spread on ground and collect in low lying areas. Runoff to a collection area can create a fire or explosion hazard.

Dry Chemical, CO2, water spray)(fog), or foam. Do not use water jet.

Isolate scene removing persons not trained if there is a firem. Move containers from fire area if there is no risk. Use water spray to keep fire exposed containers cool

Decomposition products man include the following materials: Carbon Oxides. Fire fighters should wear appropriate protective equipment and wel-contain breathing apparatus.

Use dry chemical, CO2, water spray(fog) or foam. Do not use water jet.

Section 6: Accidental Release Measures

No action should be taken with untrained personnel. Evacuate surrounding areas. Do not touch or walk through spill. Shut off all ignition sources. Provide adequate ventilation. Use appropriate protective equipment. Do not breath dust, mist, or vapor.

Stop leak if without risk. Move containers form spill area. Dilute with water and mop up if water-soluble, or absorb with inert dry material and place in appropriate waste container. Dispose via licensed waste disposal.

Stop leak if without risk. Move containers from area. Approach from upwing. Prevent run off to water source, basements, sewers, or confined areas. Contain and collect spillage with non combustible, absorbent materials, sand, vermiculite, diatomic earth and dispose by local regulation. Use spark-proof tools and explosion proof equipment.

Section 7: Handling and Storage

Use appropriate personal protective equipment. No eating, drinking, or smoking in areas of use. Persons with a history of skin sensitization should not be employed in any process in which this product is used. Avoid exposure during pregnancy. Do not ingest. Use adequate ventilation or respirator. Keep in approriate container avoiding open flames, sparks or other ignition sources. Use explosion proof equipment and non sparking tools. Use proper grounding procedures.

Store in designated flamable liquid storage areas. Protect from direct sunlight in dry, cool ventilated areas. Keep food and drink away from area. Eliminate all ignition sources. Opened containers must be carefully resealed and kept upright. Do not use unlabled containers. Use appropriate containment.

Section 8: Exposure Controls/ Personal Protection

Chemical Name / CAS No.	OSHA Exposure Limits	ACGIH Exposure Limits	Other Exposure Limits
Benzene, 1-chloro-4- (trifluoromethyl)- 98-56-6	Not Established	Not Established	Not Established
Titanium dioxide 13463-67-7	15 mg/m3 TWA (total dust)	10 mg/m3 TWA	Not Established
Fatty acid polyamide 68410-23-1	Not Established	Not Established	Not Established
Methyl ethyl ketone 78-93-3	200 ppm TWA; 590 mg/m3 TWA	300 ppm STEL 200 ppm TWA	NIOSH: 200 ppm TWA; 590 mg/m3 TWA 300 ppm STEL; 885 mg/m3 STEL
Xylol 1330-20-7	100 ppm TWA; 435 mg/m3 TWA	150 ppm STEL 100 ppm TWA	Not Established
2,4,6-Tri (dimethylaminomethyl) phenol 90-72-2	Not Established	Not Established	Not Established

SDS for: H-7480 Page 3 of 6

Benzene, ethyl- 100-41-4	100 ppm TWA; 435 mg/m3 TWA	20 ppm TWA	NIOSH: 100 ppm TWA; 435 mg/m3 TWA 125 ppm STEL; 545 mg/m3 STEL
Aromatic naphtha, type I 64742-95-6	Not Established	Not Established	Not Established

Use only with adequate ventilation. Use process enclosures, local exhaust ventilation or other engineering controls to meet exposure to airborne cotaminates above statutory limits. Use appropriate controls to keep concentration below explosive limits.

Ensure adequate ventalation by standard emmision testing procedures, Use appropriate respiratory equipment when needed.

Assure safety traning of operators in regards to handleing liquids and vapors. Follow local regulatory rules of exposure control using air purifying or air supplied mask as needed. Use appropriate protective equipment according to OSHA and NAFTA standards and labeling. Ensure eye wash stations and safety showers are available.

Wash contaminated gear and clothing before reuse.

Vapor Density: NA

Section 9: Physical and Chemical Properties

Evaporation rate: NA Partition coefficient (n- NA octanol/water):

Autoignition temperature: NA Decomposition temperature: NA

Coating VOC Lb/Gal 1.63 Viscosity: NA

Appearance: Taupe Odor: E

VAPOR PRESURE NA Odor threshold: NO DATA

DENSITY 19.71 Melting point: NA

Freezing point: NA

Boiling range: 137C

Solubility: NA

Flash point: 61°F,16°C

Flammability: NA Explosive Limits: NA

Section 10: Stability and Reactivity

These materials are stable. Under normal conditions of storage and use hazardous reactions or polymerization will not occur. Avoid all source of ignitions, sparks or flames. Do not allow vapor to accumulate in low lying areas.

STABLE

Do not expose to strong oxidizing agents, strong acids, or aliphatic amines.

Under normal use, no hazardous decomposition products are produced.

Hazardous polymerization will not occur.

Section 11: Toxicological Information

Mixture Toxicity

Inhalation Toxicity LC50: 91mg/L

Routes of Entry:

SDS for: H-7480 Page 4 of 6

pH: NA

Exposure to this material may affect the following organs:

Eyes Central Nervous System Skin Respiratory System

Effects of Overexposure

Carcinogenicity: The following chemicals comprise 0.1% or more of this mixture and are listed and/or classified as carcinogens or potential carcinogens by NTP, IARC, OSHA (mandatory listing), or ACGIH (optional listing).

CAS Number	<u>Description</u>	% Weight	Carcinogen Rating
64742-95-6	Aromatic naphtha, type I	0.2	Aromatic naphtha, type I: EU
			REACH: Present (P)
13463-67-7	Titanium dioxide	10 to 20%	Titanium dioxide: NIOSH: potential occupational carcinogen IARC: Possible human carcinogen OSHA: listed
100-41-4	Benzene, ethyl-	1	Benzene, ethyl-: IARC: Possible human carcinogen OSHA: listed

This product can be a skin and eye sensitizer. The material should washed from skin or flushed from eyes immediately. Contaminated clothing should be removed. Wear proper protective equipment. Any other acute toxicalogical information can be found in section 11.

Approximately 2% of the population can develop skin sensitivity with increasing inflamation and allergic reactions with repeated exposure.

Section 12: Ecological

No known significan effects or critical hazards.

Component Ecotoxicity

Benzene, 1-chloro-4-(trifluoromethyl)- 48 Hr EC50 Daphnia magna: 3.68 mg/L

Methyl ethyl ketone

96 Hr LC50 Pimephales promelas: 3130 - 3320 mg/L [flow-through]

48 Hr EC50 Daphnia magna: >520 mg/L; 48 Hr EC50 Daphnia magna: 5091

mg/L; 48 Hr EC50 Daphnia magna: 4025 - 6440 mg/L [Static]

Xylol

96 Hr LC50 Pimephales promelas: 13.4 mg/L [flow-through]; 96 Hr LC50 Oncorhynchus mykiss: 2.661 - 4.093 mg/L [static]; 96 Hr LC50 Oncorhynchus mykiss: 13.5 - 17.3 mg/L; 96 Hr LC50 Lepomis macrochirus: 13.1 - 16.5 mg/L [flow-through]; 96 Hr LC50 Lepomis macrochirus: 19 mg/L; 96 Hr LC50 Lepomis macrochirus: 7.711 - 9.591 mg/L [static]; 96 Hr LC50 Pimephales promelas: 23.53 - 29.97 mg/L [static]; 96 Hr LC50 Cyprinus carpio: 780 mg/L [semi-static]; 96 Hr LC50 Cyprinus carpio: >780 mg/L; 96 Hr LC50 Poecilia reticulata: 30.26 -

40.75 mg/L [static]

48 Hr EC50 water flea: 3.82 mg/L; 48 Hr LC50 Gammarus lacustris: 0.6 mg/L

Benzene, ethyl-

96 Hr LC50 Oncorhynchus mykiss: 11.0 - 18.0 mg/L [static]; 96 Hr LC50 Oncorhynchus mykiss: 4.2 mg/L [semi-static]; 96 Hr LC50 Pimephales promelas: 7.55 - 11 mg/L [flow-through]; 96 Hr LC50 Lepomis macrochirus: 32 mg/L [static]; 96 Hr LC50 Pimephales promelas: 9.1 - 15.6 mg/L [static]; 96 Hr

LC50 Poecilia reticulata: 9.6 mg/L [static] 48 Hr EC50 Daphnia magna: 1.8 - 2.4 mg/L

72 Hr EC50 Pseudokirchneriella subcapitata: 4.6 mg/L; 96 Hr EC50

Pseudokirchneriella subcapitata: >438 mg/L; 72 Hr EC50 Pseudokirchneriella

subcapitata: 2.6 - 11.3 mg/L [static]; 96 Hr EC50 Pseudokirchneriella

subcapitata: 1.7 - 7.6 mg/L [static]

SDS for: H-7480 Page 5 of 6

Section 13: Disposal Considerations

Minimize the generation of waste whenever possible. Dispose by license waste disposal contractor. Comply with local. regional, and fedral disposal regulations and legislation.

Section 14: Transport Information

Agency	Proper Shipping Name	UN Number	Packing Group	Hazard Class
DOT	PAINT	1263	II	3
IOTA	PAINT	1263	II	3

Section 15: Regulatory Information

All components are in compliance with TSCA inventory listing or are exempt.

Country Regulation All Components Listed

EU Risk Phrases

Safety Phrase

- None

Section 16: Other Information

HMIS and NAFTA rating are on a 0 to 4 rating scale with 0 minimal hazard, and 4 represent significant danger or hazard.

Hazardous Material Information System (HMIS)

HEALTH * 2 FLAMMABILITY 3 PHYSICAL HAZARD 0 PERSONAL PROTECTION G

HMIS & NFPA Hazard Rating Legend

* = Chronic Health Hazard


0 = INSIGNIFICANT

1 = SLIGHT

2 = MODERATE

3 = HIGH

National Fire Protection Association (NFPA)

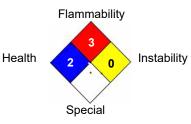

The information provided herein was believed by Induron Protective Coating to be accurate and reliable, but the user is responsible to comply with all laws and procedures whether included or not. Induron makes no warranty expressed of implied concerning the accuracy of the infomation except the product will comply with Induron specifications.

Reviewer Revision

Date Prepared: 3/10/2021

SDS for: H-7480 Page 6 of 6

SAFETY DATA SHEET

Section 1: Manufacturer's Identification

Product Name: CERAMAPRIME LV EPOXY PRIMER PART B Product Code: Q-1481

Manufacturer's Name: Induron Protective Coatings, LLC

Address: 3333 Richard Arrington Blvd. N. Birmingham, Alabama 35234

Emergency Phone: 1-800-424-9300 Information Phone: (205)324-9584

Section 2 : Hazards Identification

GHS Ratings:

Flammable liquid 2 Flash point < 23°C and initial boiling point > 35°C (95°F) **Oral Toxicity** Acute Tox. 2 Oral>5+<=50mg/kg Acute Tox. 3 **Dermal Toxicity** Dermal>200+<=1000mg/kg Skin corrosive Reversible adverse effects in dermal tissue, Draize score: >= 2.3 < 4.0 or persistent inflammation Eye corrosive 2A Eye irritant: Subcategory 2A, Reversible in 21 days Skin sensitizer Skin sensitizer 1 Carcinogen 2 Limited evidence of human or animal carcinogenicity

Reproductive toxin 1B Presumed, Based on experimental animals

GHS Hazards

H225	Highly flammable
H300	Fatal if swallowed
H311	Toxic in contact with skin
H315	Causes skin irritation
H317	May cause an allergic skin reaction
H319	Causes serious eve irritation

Suspected of causing cancer H360 May damage fertility or the unborn child

GHS Precautions

H351

SDS for: Q-1481

P201	Obtain special instructions before use
P202	Do not handle until all safety precautions have been read and understood
P210	Keep away from heat/sparks/open flames/hot surfaces - No smoking.
P233	Keep container tightly closed.
P240	Ground/bond container and receiving equipment.
P241	Use explosion-proof electrical equipment.
P242	Use only non-sparking tools.
P243	Take precautionary measures against static discharge.
P261	Avoid breathing dust/fume/gas/mist/vapours/spray.
P264	Wash equipment and contaminated skin thoroughly after handling.
P270	Do not eat, drink or smoke when using this product
P272	Contaminated work clothing should not be allowed out of the workplace.
P280	Wear protective gloves/protective clothing/eye protection/face protection.
P281	Use personal protective equipment as required
P312	Call a POISON CENTER or doctor/physician if you feel unwell
P321	Wash contaminated skin, follow Physcian's instructions for treatment.
P322	Specific measures Remove contaminated clothing and protective equipment.
P330	Rinse mouth
P361	Remove/Take off immediately all contaminated clothing

Page 1 of 6

P362 Take off contaminated clothing and wash before reuse

P363 Wash contaminated clothing before reuse

P301+P310 IF SWALLOWED: Immediately call a POISON CENTER or doctor/physician

P302+P352 IF ON SKIN: Wash with soap and water

P303+P361+P353 IF ON SKIN (or hair): Remove/Take off immediately all contaminated clothing. Rinse

skin with water/shower

P305+P351+P338 IF IN EYES: Rinse continuously with water for several minutes. Remove contact

lenses if present and easy to do - continue rinsing

P308+P313 IF exposed or concerned: Get medical advice/attention
P332+P313 If skin irritation occurs: Get medical advice/attention

P333+P313 If skin irritation or a rash occurs: Get medical advice/attention

P337+P313 Get medical advice/attention

P370+P378 In case of fire: Use CO2, water spray, foam, or dry chemical to extinguish.

P405 Store locked up

P403+P235 Store in a well ventilated place. Keep cool

P501 Dispose of contents/container in accordance to approriate regulations and laws.

Signal Word: Danger









Section 3: Composition / Information on Ingredients

Chemical Name	CAS number	Weight Concentration %
Talc	14807-96-6	22.00%
Dimethyl carbonate	616-38-6	15.00%
Xylol	1330-20-7	11.00%
Hexone	108-10-1	10.00%
Kaolin	1332-58-7	7.00%
4,4'-Isopropylidenediphenol, oligomeric reaction products with 1-chloro-2,3-epoxypropane	25068-38-6	5.00%
Benzene, ethyl-	100-41-4	3.00%

Section 4: First Aid Measures

Move the exposed person to fresh air. If vapors are still present the rescuer should wear the appropriate mask. If breathing is irregular or arrest occurs use artificial respiration by trained personnel. Loosen tight fitting clothing, Get medical aid immediately.

Immediately flush eyes with plenty of water for at least 15 minutes. Regularly lift upper and lower eyelids during flushing. Remove contact lenses. Get medical aid.

Flush contaminated skin with water. Remove contaminated cloths, avoiding skin contact while doing so. Get medical attention. Clean contaminated shoes thoroughly before reuse.

Wash mouth out thoroughly. Do not induce vomiting unless directed by medical personnel. Get medical attention No specific treatment. Treat symptomatically. Contact poison treatment specialist immediately if large quantities have been inhaled or ingested.

Section 5: Fire Fighting Measures

Flash Point: 15 C (59 F)

LEL: 1.0% UEL: 8.0%

For flammable liquid: Can burst from pressure if in sealed container and heated, with risk of subsequent explosion. Vapors are heavier than air,

SDS for: Q-1481 Page 2 of 6

can spread on ground and collect in low lying areas. Runoff to a collection area can create a fire or explosion hazard.

Dry Chemical, CO2, water spray)(fog), or foam. Do not use water jet.

Isolate scene removing persons not trained if there is a firem. Move containers from fire area if there is no risk. Use water spray to keep fire exposed containers cool

Decomposition products man include the following materials: Carbon Oxides.

Fire fighters should wear appropriate protective equipment and wel-contain breathing apparatus.

Use dry chemical, CO2, water spray(fog) or foam. Do not use water jet.

Section 6: Accidental Release Measures

No action should be taken with untrained personnel. Evacuate surrounding areas. Do not touch or walk through spill. Shut off all ignition sources. Provide adequate ventilation. Use appropriate protective equipment. Do not breath dust, mist, or vapor.

Stop leak if without risk. Move containers form spill area. Dilute with water and mop up if water-soluble, or absorb with inert dry material and place in appropriate waste container. Dispose via licensed waste disposal.

Stop leak if without risk. Move containers from area. Approach from upwing. Prevent run off to water source, basements, sewers, or confined areas. Contain and collect spillage with non combustible, absorbent materials, sand, vermiculite, diatomic earth and dispose by local regulation. Use spark-proof tools and explosion proof equipment.

Section 7: Handling and Storage

Use appropriate personal protective equipment. No eating, drinking, or smoking in areas of use. Persons with a history of skin sensitization should not be employed in any process in which this product is used. Avoid exposure during pregnancy. Do not ingest. Use adequate ventilation or respirator. Keep in approriate container avoiding open flames, sparks or other ignition sources. Use explosion proof equipment and non sparking tools. Use proper grounding procedures.

Store in designated flamable liquid storage areas. Protect from direct sunlight in dry, cool ventilated areas. Keep food and drink away from area. Eliminate all ignition sources. Opened containers must be carefully resealed and kept upright. Do not use unlabled containers. Use appropriate containment.

Section 8: Exposure Controls/ Personal Protection

Chemical Name / CAS No.	OSHA Exposure Limits	ACGIH Exposure Limits	Other Exposure Limits
Talc 14807-96-6	Not Established	2 mg/m3 TWA (particulate matter containing no asbestos and <1% crystalline silica, respirable fraction)	NIOSH: 2 mg/m3 TWA (containing no Asbestos and <1% Quartz, respirable dust)
Dimethyl carbonate 616-38-6	Not Established	Not Established	Not Established
Xylol 1330-20-7	100 ppm TWA; 435 mg/m3 TWA	150 ppm STEL 100 ppm TWA	Not Established
Hexone 108-10-1	100 ppm TWA; 410 mg/m3 TWA	75 ppm STEL 20 ppm TWA	NIOSH: 50 ppm TWA; 205 mg/m3 TWA 75 ppm STEL; 300 mg/m3 STEL
Kaolin 1332-58-7	15 mg/m3 TWA (total dust); 5 mg/m3 TWA (respirable fraction)	2 mg/m3 TWA (particulate matter containing no asbestos and <1% crystalline silica, respirable fraction)	NIOSH: 10 mg/m3 TWA (total dust); 5 mg/m3 TWA (respirable dust)
4,4'-Isopropylidenediphenol, oligomeric reaction products with 1-chloro-2,3-epoxypropane 25068-38-6	Not Established	Not Established	Not Established

SDS for: Q-1481 Page 3 of 6

Benzene, ethyl- 100-41-4	100 ppm TWA; 435 mg/m3 TWA	20 ppm TWA	NIOSH: 100 ppm TWA; 435 mg/m3 TWA 125 ppm STEL; 545
			mg/m3 STEL

Use only with adequate ventilation. Use process enclosures, local exhaust ventilation or other engineering controls to meet exposure to airborne cotaminates above statutory limits. Use appropriate controls to keep concentration below explosive limits.

Ensure adequate ventalation by standard emmision testing procedures, Use appropriate respiratory equipment when needed.

Assure safety traning of operators in regards to handleing liquids and vapors. Follow local regulatory rules of exposure control using air purifying or air supplied mask as needed. Use appropriate protective equipment according to OSHA and NAFTA standards and labeling. Ensure eye wash stations and safety showers are available.

Wash contaminated gear and clothing before reuse.

Section 9: Physical and Chemical Properties

Evaporation rate: NA Partition coefficient (n- NA octanol/water):

Autoignition temperature: NA Decomposition temperature: NA

Coating VOC Lb/Gal 3.16 Viscosity: NA

Appearance: Taupe Odor: E

VAPOR PRESURE NA Odor threshold: NO DATA

Vapor Density: NA pH: NA
DENSITY 10.40 Melting point: NA
Freezing point: NA Solubility: NA

Flammability: NA Explosive Limits: NA

Section 10: Stability and Reactivity

These materials are stable. Under normal conditions of storage and use hazardous reactions or polymerization will not occur. Avoid all source of ignitions, sparks or flames. Do not allow vapor to accumulate in low lying areas.

STABLE

Do not expose to strong oxidizing agents, strong acids, or aliphatic amines.

Under normal use, no hazardous decomposition products are produced.

Hazardous polymerization will not occur.

Section 11: Toxicological Information

Mixture Toxicity

Oral Toxicity LD50: 45mg/kg Dermal Toxicity LD50: 635mg/kg Inhalation Toxicity LC50: 51mg/L

Routes of Entry:

SDS for: Q-1481 Page 4 of 6

Exposure to this material may affect the following organs:

Eyes Kidneys Liver Central Nervous System Skin Cardiovascular System

Respiratory System

Effects of Overexposure

Carcinogenicity: The following chemicals comprise 0.1% or more of this mixture and are listed and/or classified as carcinogens or potential carcinogens by NTP, IARC, OSHA (mandatory listing), or ACGIH (optional listing).

<u>CAS Number</u> <u>Description</u> <u>% Weight</u> <u>Carcinogen Rating</u>

108-10-1 Hexone 10 Hexone: IARC: Possible human

carcinogen OSHA: listed

100-41-4 Benzene, ethyl-: IARC: Possible

human carcinogen

OSHA: listed

This product can be a skin and eye sensitizer. The material should washed from skin or flushed from eyes immediately. Contaminated clothing should be removed. Wear proper protective equipment. Any other acute toxicalogical information can be found in section 11.

Approximately 2% of the population can develop skin sensitivity with increasing inflamation and allergic reactions with repeated exposure.

Section 12: Ecological

No known significan effects or critical hazards.

Component Ecotoxicity

Talc 96 Hr LC50 Brachydanio rerio: >100 g/L [semi-static]

Xylol 96 Hr LC50 Pimephales promelas: 13.4 mg/L [flow-through]; 96 Hr LC50

Oncorhynchus mykiss: 2.661 - 4.093 mg/L [static]; 96 Hr LC50 Oncorhynchus mykiss: 13.5 - 17.3 mg/L; 96 Hr LC50 Lepomis macrochirus: 13.1 - 16.5 mg/L [flow-through]; 96 Hr LC50 Lepomis macrochirus: 19 mg/L; 96 Hr LC50 Lepomis macrochirus: 7.711 - 9.591 mg/L [static]; 96 Hr LC50 Pimephales promelas: 23.53 - 29.97 mg/L [static]; 96 Hr LC50 Cyprinus carpio: 780 mg/L [semi-static]; 96 Hr LC50 Cyprinus carpio: >780 mg/L; 96 Hr LC50 Poecilia reticulata: 30.26 -

40.75 mg/L [static]

48 Hr EC50 water flea: 3.82 mg/L; 48 Hr LC50 Gammarus lacustris: 0.6 mg/L

Hexone 96 Hr LC50 Pimephales promelas: 496 - 514 mg/L [flow-through]

48 Hr EC50 Daphnia magna: 170 mg/L

96 Hr EC50 Pseudokirchneriella subcapitata: 400 mg/L

Benzene, ethyl-96 Hr LC50 Oncorhynchus mykiss: 11.0 - 18.0 mg/L [static]; 96 Hr LC50

Oncorhynchus mykiss: 4.2 mg/L [semi-static]; 96 Hr LC50 Pimephales

promelas: 7.55 - 11 mg/L [flow-through]; 96 Hr LC50 Lepomis macrochirus: 32 mg/L [static]; 96 Hr LC50 Pimephales promelas: 9.1 - 15.6 mg/L [static]; 96 Hr

LC50 Poecilia reticulata: 9.6 mg/L [static] 48 Hr EC50 Daphnia magna: 1.8 - 2.4 mg/L

72 Hr EC50 Pseudokirchneriella subcapitata: 4.6 mg/L; 96 Hr EC50

Pseudokirchneriella subcapitata: >438 mg/L; 72 Hr EC50 Pseudokirchneriella

subcapitata: 2.6 - 11.3 mg/L [static]; 96 Hr EC50 Pseudokirchneriella

subcapitata: 1.7 - 7.6 mg/L [static]

Section 13: Disposal Considerations

Minimize the generation of waste whenever possible. Dispose by license waste disposal contractor. Comply with local. regional, and fedral disposal regulations and legislation.

SDS for: Q-1481 Page 5 of 6

Section 14: Transport Information

Agency	Proper Shipping Name	UN Number	Packing Group	Hazard Class
DOT	PAINT	1263	II	3
IATA	PAINT	1263	II	3

Section 15: Regulatory Information

All components are in compliance with TSCA inventory listing or are exempt.

Country Regulation All Components Listed

EU Risk Phrases

Safety Phrase

- None


Section 16: Other Information

HMIS and NAFTA rating are on a 0 to 4 rating scale with 0 minimal hazard, and 4 represent significant danger or hazard.

Hazardous Material Information System (HMIS)

HEALTH 2 HMIS & NFPA Hazard Rating Legend * = Chronic Health Hazard 0 = INSIGNIFICANT 1 = SLIGHT 2 = MODERATE 3 = HIGH

National Fire Protection Association (NFPA)

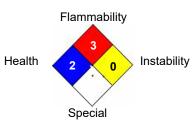

The information provided herein was believed by Induron Protective Coating to be accurate and reliable, but the user is responsible to comply with all laws and procedures whether included or not. Induron makes no warranty expressed of implied concerning the accuracy of the infomation except the product will comply with Induron specifications.

Reviewer Revision

Date Prepared: 5/24/2022

SDS for: Q-1481 Page 6 of 6